

Luxmeter LX 100



TECHNICAL FEATURES

Measuring range	From 0.0 to 150 000 Lux From 0.00 to 13940 fc
Directional sensitivity (f2) ¹	< 6%
Linearity (f3) ¹	< 3%
Measurement capability	3 days – 03D00H00M
Display	Backlit LCD graphic 128 x 64
Conditions of use (°C/%RH/m)	From 0°C to +50°C. In non-condensation condition. From 0 to 2000 m.
Storage temperature	From 0°C to +50°C
Housing dimension (without sensor)	120 x 58 x 34 mm
Weight (housing+sensor+battery)	185 g
Mini-USB plug	For USB power supply adaptor
Power supply	3 batteries 1.5 V type LR3-AAA
Battery life	72 hours min, continuous operation
European directives	2004/108/EC EMC; 2006/95/EC Low voltage; 2011/65/EU RoHS II; 2012/19/EU WEEE



¹ The f2 and f3 coefficient are defined according to the French NF C 42-710 standard.

ILLUMINANCE MEASURING RANGE

♦ from 0.0 to 150 000 Lux

Display	Unit	Resolution	Accuracy*
0.0 to 10.0	lx	0.1	±3% of reading or ±3 lux
10.0 to 99.9	lx	0.1	
100.0 to 999.9	lx	0.1	
1000 to 9999	lx	1	
10.00 to 99.99	klx	0.01	
100.0 to 150.0	klx	0.1	

♦ from 0 to 13940 fc

Display	Unit	Resolution	Accuracy*
0.00 to 1.00	fc	0.01	±3% of reading or ±0.28 fc
1.00 to 99.99	fc	0.01	
100.0 to 999.9	fc	0.1	
1000 to 9999	fc	1	
10.00 to 13.94	kfc	0.01	

Instantaneous measurement, display illuminance for local measurements.

With timed measurement:

- Illuminance min/max values display
- Illuminance averaged value calculation

With relative illuminance function:

- Allows a relative measurement to a reference point for the quantification of a luminous contribution or an illuminance decrease.

With hold function:

- Allows to avoid illuminance noise or to save on screen local measurement.

Measurement saving when unexpected power cut occurs.

* All the accuracies indicated in this technical datasheet were stated in laboratory conditions, and can be guaranteed for measurements carried out in the same conditions, or carried out with calibration compensation.



- ① ② ③ Functions keys —
- ④ Key back to previous screen
- ⑤ Screen key
- ⑥ On / Off key


Settings

Configurable, **LX100** allows:


Contrast and backlight settings



Select language (french or english) and measuring units (lux or fc)

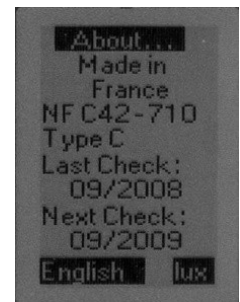

Measurement

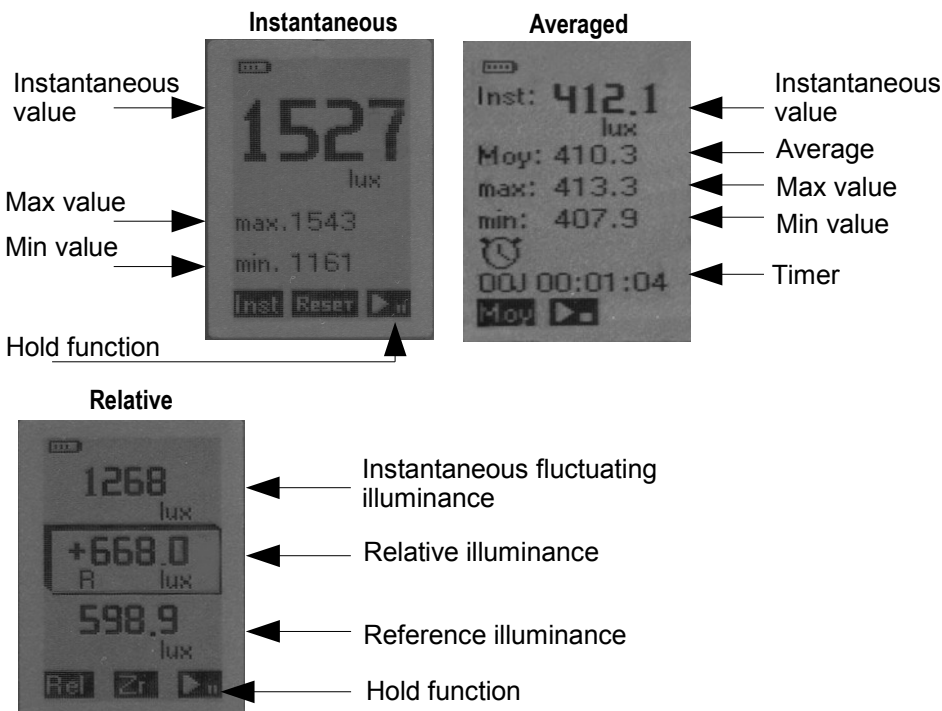

SUPPLIED WITH

- **LX100** housing with silicon photodiode sensor and glass filter correction
- Transport case
- 3 batteries LR3-AAA
- Calibration certificate
- **LX100** user manual

大華高科股份有限公司

www.taiwah.com.tw info@taiwah.com.tw

台北 TEL: (02) 2592 - 5119 Fax: (02) 2592 - 3577
 台中 TEL: (04) 2707 - 2269 Fax: (04) 2707 - 1799
 台南 TEL: (06) 243 - 2338 Fax: (06) 243 - 2339

KIMO® 為 KIMO 儀器公司的註冊商標。

資料中任何商標和圖片為本公司版權所有。未經本公司書面許可不得以任何形式複製，轉印，發行或儲存資料中所包含的訊息。本資料如有變更，恕不另行通知。